



# the **play inspection** company

---

## Annual Inspection

Charney Hall and Field Trust

Charney Field

End of New Road, Charney Bassett, Oxfordshire, OX12  
0ER



**API** Associate



Unit 5, Glenmore Business Park, Blackhill Road, Poole, Dorset, BH16 6NL  
t- 01202 590675 e- info@playinspections.co.uk

[www. playinspections .co.uk](http://www.playinspections.co.uk)

## Inspection Scope for RPII Inspection Methodology

This document outlines the RPII scope for inspections undertaken by the Inspectors listed as Annual Inspectors on the RPII Register of Inspectors when undertaking Indoor Annual, Outdoor Annual, Outdoor Operational and Outdoor Routine inspections.

Inspections are undertaken with reference to the standards listed in this preamble only; where no date for the standard is given it will be the standard that is current at the time of inspection except where overlap periods are granted by the standards committee when standards are updated. The information contained in reports is provided to assist the owner/operator in fulfilling their responsibilities as detailed in the relevant standard. Other standards referenced within the listed standards do not form part of the inspection, unless they are also explicitly listed here.

The following standards are relevant to all installations of equipment that are publicly accessible to users; this includes public parks, pay and play parks, schools, nurseries, public houses, holiday parks, indoor play centres, farm parks etc. All equipment used or employed in publicly accessible areas should meet with the requirements of the relevant standards (listed below):

BS EN 1176 Parts 1, 2, 3, 4, 5, 6, 10 & 11 Playground equipment intended for permanent installation outdoors & indoors.

BS EN 1176 Part 7 - 'Guidance on Installation, Inspection, Maintenance and Operation' (this document gives guidance to the owners/operators of the facility on the installation, inspection, maintenance and operation of playground equipment, excluding ancillary items).

In the United Kingdom the National Foreword forms an important part to the understanding and implementation of the recommendations set out in this document. It clarifies the application of the document within the UK as best practice guidance, as the document has been used since its initial publication. Therefore, in the UK this standard (BS EN 1176 – Part 7) contains no requirements and needs to be read and implemented as guidance, with the use of the term 'shall' therefore becoming a recommendation, as in the term 'should'.

Domestic play equipment falls outside of the scope of BS EN 1176 and has its own standards (BS EN 71 series – Safety of Toys). Where domestic equipment can be identified this will be acknowledged in the report but any comments concerning compliance will follow the requirements and recommendations of BS EN 1176.

When water play items, including spray parks, are inspected any comments concerning compliance within the inspection will refer to BS EN 1176. We have not assessed these against the requirements of BS EN 17232 (Water play equipment and features).

Other equipment that is not clearly identified as unsupervised or domestic (natural play, self-build equipment etc.) will be assessed for compliance with the relevant standard listed below:

**BS EN 15312** Free access multi-sports equipment  
**BS EN 14974** Skateparks  
**BS EN 16630** Permanently installed outdoor fitness equipment  
**BS EN 16899** Parkour equipment (plus RPII/API guidance notes)

Annual and Post Installation inspections will take into consideration compliance with these current standards, and defects related to wear and vandalism. Items not listed in the report have not been included in the inspection. The inspection will cover the playground equipment and the active area (that area which is obviously part of the playground), nominally up to three metres around, the fence line if closer, or other areas as agreed.

Operational inspections only take into consideration defects related to cleanliness, equipment ground clearances, ground surface finishes, exposed foundations, sharp edges, missing parts, excessive wear (of moving parts) structural integrity, wear and vandalism.

Routine visual inspections relate only to the most obvious defects such as broken or missing parts, litter, vandalism and issues created by severe weather conditions (the intention is to identify hazards created by storm damage).

All inspections are non-dismantling, non-destructive and do not include any structural, toxicology or impact assessments defined in the standard; however, the inspector will undertake a manual test for stability and if equipment fails under manual load, or any other hazard is identified as an unacceptable risk, the owner/operator will be notified as soon as practicably possible.

The inspector will access all reasonably accessible equipment and will assess all reasonably accessible parts above the standing surface. Where it is not possible to access parts of the equipment without employing an alternative means of access the report will record the action required by the owner/operator to ensure the continued safe use of the equipment.

Ancillary equipment will be assessed using the inspector's knowledge and experience of the standards named in this document. (Note: Ancillary items are not included in the specific equipment-type parts of the EN 1176 series; hence they are not assessed for compliance with EN 1176 series and are subject to a general safety assessment).

The owner/operator is responsible for the overall safety of the equipment and area.

The inspector will not undertake any of the following works unless specifically agreed in writing at the time of order:

Checking the depth and underlying structural integrity of any surface areas and/or carrying out any testing of the impact attenuating properties of any surfaces; the identification of any corrosion, rot or other deterioration in any apparatus or equipment other than by an external inspection; the inspection of any equipment (or part thereof) that is beneath the playing surface (loose-fill materials may be moved to expose foundations); tightening any bolts, hinges or other fixing devices on any apparatus or equipment; assessing or inspecting any electrical installations contained on any site and/or apparatus and/or equipment; assessing or inspecting any water supplies and/or water features and/or any associated computerised systems (including carrying out any programming); where planting or trees are mentioned in the report no assessments of toxicity, suitability or condition are undertaken – the owner/operator should have suitable inspections provided by a competent person.

The owner/operator should have a 'design risk assessment' provided by the manufacturer/designer of the area for the equipment and location in which the facility is installed.

The operator is responsible for managing risks of their provision and is required by law to carry out a 'suitable and sufficient assessment' of the risks associated with a site or activity. This inspection shall be considered as contributing to the operator's discharge of this responsibility.

The details contained within the report are a snapshot of the condition at the time of inspection only and subsequent events may affect the condition of the facility. Suggested remedial actions are based on the knowledge and experience of the inspector and/or that of the inspection company. The owner/operator should always seek the advice of the manufacturer or a competent person when undertaking repairs and/or modifications to equipment.

A full copy of the Play Inspection Company Ltd. Terms & Conditions is available on our website ([www.playinspections.co.uk](http://www.playinspections.co.uk))

The operator is responsible for following the guidance of the relevant standards. The standards give guidance on the installation, inspection, maintenance and operation of the various types of facilities. The inspection guidance is listed in Table 1, with an indication of which parts will be included in an RPII Annual or Post-Installation Inspection. The relevant standards also contain additional parts which the operator should follow.

Inspection recommendations of relevant standards Refer to relevant standards for full text	Annual Main	RPII Annual/ Post Installation Inspection
6.1 d) Overall levels of safety of equipment (see note 1)	✓	✓ [1]
6.1 d) Overall levels of safety of foundations (see note 1)	✓	✓ [1]
6.1 d) Overall levels of safety of playing surfaces (see note 2)	✓	✓ [2]
6.1 d) Compliance with the relevant parts of the standard and or risk assessment (see note 3)	✓	✓ [3]
6.1 d) Effects of weather	✓	✓
6.1 d) Presence of rot, decay or corrosion (see note 1)	✓	✓ [1]
6.1 d) Assessment of repairs made or added or replaced components (see note 4)	✓	✓ [4]
6.1 d) Excavation or dismantling/additional measures	✓	✗
6.2.1 Assessment of glass reinforced plastics (see note 5)	✓	✓ [5]
6.2.1 Inspection of one post equipment (see note 1)	✓	✓ [1]
6.2.4 Undertaking the Operators inspection protocol	✓	✗

NB: The clause numbers in table 1 are taken from BS EN 1176 - Part 7:2020. The content is equally applicable to all other relevant standards listed herein. Playgrounds contain a range of equipment from different manufacturers and installed over a number of years; operators should implement any guidance provided by the manufacturer. Item specific detail is not readily available to RPII Playground Inspectors, whose report contributes to the operator's overall Annual Main Inspection as detailed in the relevant standards.

[1] A manual test only is undertaken for stability. Wear and instability are only detectable where readily apparent without dismantling or destruction and without the use of tools, excavation or specialist equipment. Rot and corrosion are tested or with a hammer and/or steel rod. Decay in timber may exist which can only be found with specialist equipment.

[2] Only the visible condition and dimensional compliance of surface extent is considered. Neither testing of impact attenuating properties nor measurement of the thickness of bound surfaces are undertaken on RPII annual inspections.

[3] The inspection assesses compliance where this can be tested on site using manual methods without dismantling, destruction and without the use of tools or specialist equipment.

[4] The operator should use manufacturer's recommended parts, or equivalent. We are unable to verify if such parts have been used, and any subsequent change in quality or performance.

[5] Visible glass fibres will be noted in reports. The operator is responsible for repairs or replacement.

# Risk Assessment Matrix

			Scores in the report are multiplication factors of Likelihood x Severity					
			Severity>>					
<b>Likelihood</b>	Very High probability, if the situation is not addressed an accident is almost certain.	5	Very High	VL (5)	L (10)	M (15)	H (20)	VH (25)
	High probability an accident is probable without any added factor.	4	High	VL (4)	L (8)	M (12)	H (16)	H (20)
	Moderate probability an incident is foreseeable.	3	Moderate	VL (3)	L (6)	L (9)	M (12)	M (15)
	Some probability, requires a combination of factors to take place.	2	Low	VL (2)	VL (4)	L (6)	L (8)	L (10)
	No significant probability; lightning strike, freak accident.	1	Very Low	VL (1)	VL (2)	VL (3)	VL (4)	VL (5)
			Very Low	Low	Moderate	High	Very High	
			1	2	3	4	5	
			No injury likely e.g. damaged or soiled clothing, minor bruising, grazes	Minor injury, laceration or bruising requiring first aid only	Injury requiring medical intervention e.g. cuts requiring stitches	Serious injury including concussions or fracture of long bones	Severe injury involving a potential life changing injury or fatality	
			<b>Severity&gt;&gt;</b>					
<p>Note 1: The total risk scores included within our reports are a multiplication factor of the calculated Likelihood and Severity of each finding. Both Likelihood and Severity are given a number between 1 - 5 as shown on the matrix above and these two numbers are then multiplied together to give the total risk score that is shown against defects on the report. Total risk scores can be divided in both directions, i.e. a total risk score of 12 could be a Likelihood (3) x Severity (4) or Likelihood (4) x Severity (3).</p> <p>Note 2: When we inspect we only see a snapshot of the current condition of the equipment. It is the operators responsibility to ensure that there is a continuing level of maintenance to keep the equipment in good working order and the site fit for use.</p>								

**Equipment has been assessed to the following standards where relevant:**

- BS EN 1176 Parts 1-11 (Playground equipment and surfacing)
- BS EN 14974 (Facilities for users of roller sports equipment)
- BS EN 15312 (Free access multi-sports equipment)
- BS EN 16899 (Parkour Equipment)
- BS EN 16630 (Outdoor Fitness Equipment).

# Charney Field

Inspection Ref: 2613246

Site Ref: 22953

Inspected: 12-February-2025 - 13:41 by Garrick O'Connor (RPII Annual Inspector)

Risk Assessment: 12 Moderate Risk

**Location:**

The site is located in an area of public open space and is not directly overlooked by any properties in the local community.

**Disabled Access:**

Severely limited access – an area that presents serious barriers to disabled people, even when skilled help is at hand.

**i** 6 - Low Risk

**Item:** Site General  
**Manufacturer:** Owner/Operator  
**Surface Type:** N/A  
**Item Quantity:** 1  
**Equipment Compliance:** N/A  
**Surface Area Compliance:** N/A

**Total Findings:** 1



**Finding 1**

There is some evidence of rot in the timber edging - Monitor for any further deterioration and replace as required

**i** 8 - Low Risk

**Item:** Gate - Self Closing  
**Manufacturer:** Not Identified  
**Surface Type:** Grass  
**Item Quantity:** 2  
**Equipment Compliance:** N/A  
**Surface Area Compliance:** N/A

**Total Findings:** 4



**Finding 1**

There are openings that are less than 12mm that could trap or crush fingers - Provide a 12mm gap throughout full range of motion at both sides of gate

**Finding 2**

The gate is closing too quickly (less than 4 seconds) - Take corrective action to ensure that the gate closes in 4-8 seconds from 90 degrees

**Finding 3**

There are projecting bolt thread(s) present - Remove excess thread length and deburr or provide cap

**Finding 4**

There is some evidence of rot in the timber - Monitor for any further deterioration and replace as required

**i 8 - Low Risk**

**Item:** Fencing - Timber  
**Manufacturer:** Not Identified  
**Surface Type:** Grass  
**Item Quantity:** 1  
**Equipment Compliance:** N/A  
**Surface Area Compliance:** N/A



**Total Findings:** 3

**Finding 1**

The configuration of the fence timbers poses a risk of head and neck entrapment in the fence tops - Monitor - No remedial work recommended

**Finding 2**

There are areas or parts of the timber on the structure that have rotted and sheared at base level - Replace all affected timbers

**Finding 3**

There is some strimmer / machinery damage apparent on the posts, this can penetrate the preservative applied to the timber and accelerate the rotting process - Monitor for any deterioration (rot) and replace as required

**i 4 - Very Low Risk**

**Item:** Sign  
**Manufacturer:** Not Identified  
**Surface Type:** Grass  
**Item Quantity:** 1  
**Equipment Compliance:** N/A  
**Surface Area Compliance:** N/A



**Total Findings:** 1

**Finding 1**

This item is satisfactory - no work required -

**!** 12 - Moderate Risk

**Item:** 2 Bay 2 Flat 2 Cradle  
**Manufacturer:** Not Identified  
**Surface Type:** Bark Mulch  
**Item Quantity:** 1  
**Equipment Compliance:** No  
**Surface Area Compliance:** Yes



**Total Findings:** 5

**Finding 1**

The depth of the loose fill surfacing is lower than the recommended depth specified in BS EN 1176; the free height of fall of the equipment is less than 2.0m and a minimum of 300mm depth should be provided (including an extra 100mm to allow for compaction and displacement as per BS EN 1176 Part 1 - Table 4) - Top up loose fill surfacing to recommended levels

**Finding 2**

The chain openings are in excess of the 8.6mm as recommended by BS EN 1176 - Monitor - No action given the risk assessment

**Finding 3**

There is some notable evidence of chain wear - Monitor for any further deterioration and replace when 40% worn

**Finding 4**

Rigid bird deterrents have been used on the swing cross beam - Consider replacing with soft touch deterrents such as cable ties

**Finding 5**

There are areas or parts of the timber posts that have rotted - Replace all affected timbers

**i** 6 - Low Risk

**Item:** Four Way Springer  
**Manufacturer:** Fahr Industries  
**Surface Type:** Grass Matrix Tiles  
**Item Quantity:** 1  
**Equipment Compliance:** Yes  
**Surface Area Compliance:** Yes



**Total Findings:** 1

**Finding 1**

The paintwork on this item has been damaged or worn exposing the metal underneath which is rusting / corroding - Treat affected areas and repaint

**i** 4 - Very Low Risk

**Item:** Wetpour Animal  
**Manufacturer:** Playtop  
**Surface Type:** Wet Pour  
**Item Quantity:** 1  
**Equipment Compliance:** Yes  
**Surface Area Compliance:** Yes



**Total Findings:** 1

**Finding 1**

This item is satisfactory - no work required -

**i** 8 - Low Risk

**Item:** Multi Play (Junior)  
**Manufacturer:** Not Identified  
**Surface Type:** Bark Mulch  
**Item Quantity:** 1  
**Equipment Compliance:** No  
**Surface Area Compliance:** Yes



**Total Findings:** 6

**Finding 1**

The item fails to meet the requirements of BS EN 1176 Part 1 4.2.7.2 head and neck entrapment in the barriers and/or steps - Monitor - No action given the risk assessment

**Finding 2**

There is/are finger entrapment/s in the bridge connections and the item fails to meet the requirements of BS EN 1176 Part 1 4.2.7.6 Entrapment of fingers - Monitor - No action given the risk assessment

**Finding 3**

There is or are fixings missing on the item - Replace all missing fixings

**Finding 4**

The fixings have corroded excessively - Replace all corroded fixings

**Finding 5**

There is some wear to the shackles. - Monitor for any further deterioration and replace when 40% worn

**Finding 6**

The depth of the loose fill surfacing is lower than the recommended depth specified in BS EN 1176; the free height of fall of the equipment is less than 2.0m and a minimum of 300mm depth should be provided (including an extra 100mm to allow for compaction and displacement as per BS EN 1176 Part 1 - Table 4) - Top up loose fill surfacing to recommended levels

**i** 8 - Low Risk

**Item:** Football Goal  
**Manufacturer:** Not Identified  
**Surface Type:** Grass  
**Item Quantity:** 2  
**Equipment Compliance:** N/A  
**Surface Area Compliance:** N/A

**Total Findings:** 4



**Finding 1**

NB: We have undertaken a maintenance inspection only of the football goal(s); full load testing falls outside the scope of our inspection. - Implement load testing as required

**Finding 2**

The item is slightly loose in its foundations - Monitor for any further deterioration and repair as required

**Finding 3**

The paintwork on this item has been damaged or worn exposing the metal underneath which is rusting / corroding - Treat affected areas and repaint

**Finding 4**

The net is damaged and requires removal / replacement - Replace

**i** 4 - Very Low Risk

**Item:** Basketball Post  
**Manufacturer:** Baseline  
**Surface Type:** Grass  
**Item Quantity:** 1  
**Equipment Compliance:** Yes  
**Surface Area Compliance:** N/A

**Total Findings:** 1



**Finding 1**

This item is satisfactory - no work required -

## Findings information

**i** 6 - Low Risk (Finding 1)

**Item:** Ancillary Items - Site General  
**Manufacturer:** Owner/Operator

**Risk Level:** L - Low Risk  
**Surface:** N/A



**Finding:** There is some evidence of rot in the timber edging **Action:** Monitor for any further deterioration and replace as required

**i** 8 - Low Risk (Finding 1)

**Item:** Gates - Gate - Self Closing  
**Manufacturer:** Not Identified

**Risk Level:** L - Low Risk  
**Surface:** Grass



**Finding:** There are openings that are less than 12mm that could trap or crush fingers

**Action:** Provide a 12mm gap throughout full range of motion at both sides of gate

**i** 8 - Low Risk (Finding 2)

**Item:** Gates - Gate - Self Closing  
**Manufacturer:** Not Identified

**Risk Level:** L - Low Risk  
**Surface:** Grass



**Finding:** The gate is closing too quickly (less than 4 seconds)

**Action:** Take corrective action to ensure that the gate closes in 4-8 seconds from 90 degrees

**i** 8 - Low Risk (Finding 3)

**Item:** Gates - Gate - Self Closing  
**Manufacturer:** Not Identified

**Risk Level:** L - Low Risk  
**Surface:** Grass



**Finding:** There are projecting bolt thread(s) present

**Action:** Remove excess thread length and deburr or provide cap

**i** 6 - Low Risk (Finding 4)

**Item:** Gates - Gate - Self Closing  
**Manufacturer:** Not Identified

**Risk Level:** L - Low Risk  
**Surface:** Grass



**Finding:** There is some evidence of rot in the timber

**Action:** Monitor for any further deterioration and replace as required

**i** 5 - Very Low Risk (Finding 1)

**Item:** Fences - Fencing - Timber  
**Manufacturer:** Not Identified

**Risk Level:** V - Very Low Risk  
**Surface:** Grass



**Finding:** The configuration of the fence timbers poses a risk of head and neck entrapment in the fence tops **Action:** Monitor - No remedial work recommended

**i** 8 - Low Risk (Finding 2)

**Item:** Fences - Fencing - Timber  
**Manufacturer:** Not Identified

**Risk Level:** L - Low Risk  
**Surface:** Grass



**Finding:** There are areas or parts of the timber on the structure that have rotted and sheared at base level

**Action:** Replace all affected timbers

**i** 6 - Low Risk (Finding 3)

**Item:** Fences - Fencing - Timber  
**Manufacturer:** Not Identified

**Risk Level:** L - Low Risk  
**Surface:** Grass



**Finding:** There is some strimmer / machinery damage apparent on the posts, this can penetrate the preservative applied to the timber and accelerate the rotting process

**Action:** Monitor for any deterioration (rot) and replace as required

**i** 8 - Low Risk (Finding 1)

**Item:** Swings - 2 Bay 2 Flat 2 Cradle  
**Manufacturer:** Not Identified

**Risk Level:** L - Low Risk  
**Surface:** Bark Mulch



**Finding:** The depth of the loose fill surfacing is lower than the recommended depth specified in BS EN 1176; the free height of fall of the equipment is less than 2.0m and a minimum of 300mm depth should be provided (including an extra 100mm to allow for compaction and displacement as per BS EN 1176 Part 1 - Table 4)

**Action:** Top up loose fill surfacing to recommended levels

**i** 5 - Very Low Risk (Finding 2)

**Item:** Swings - 2 Bay 2 Flat 2 Cradle  
**Manufacturer:** Not Identified

**Risk Level:** V - Very Low Risk  
**Surface:** Bark Mulch




**Finding:** The chain openings are in excess of the 8.6mm as recommended by BS EN 1176 **Action:** Monitor - No action given the risk assessment

**i** 6 - Low Risk (Finding 3)

**Item:** Swings - 2 Bay 2 Flat 2 Cradle  
**Manufacturer:** Not Identified

**Risk Level:** L - Low Risk  
**Surface:** Bark Mulch

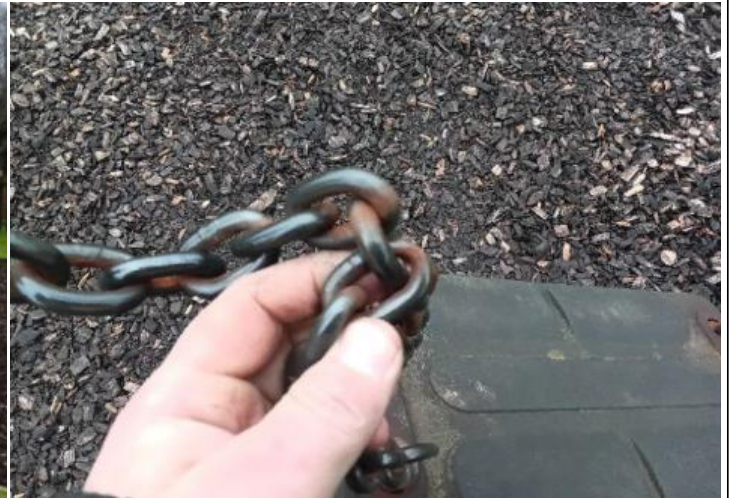

**Finding:** There is some notable evidence of chain wear

**Action:** Monitor for any further deterioration and replace when 40% worn

**i** 6 - Low Risk (Finding 4)

**Item:** Swings - 2 Bay 2 Flat 2 Cradle  
**Manufacturer:** Not Identified

**Risk Level:** L - Low Risk  
**Surface:** Bark Mulch



**Finding:** Rigid bird deterrents have been used on the swing cross beam

**Action:** Consider replacing with soft touch deterrents such as cable ties

 12 - Moderate Risk (Finding 5)

**Item:** Swings - 2 Bay 2 Flat 2 Cradle  
**Manufacturer:** Not Identified

**Risk Level:** M - Moderate Risk  
**Surface:** Bark Mulch



**Finding:** There are areas or parts of the timber posts that have rotted

**Action:** Replace all affected timbers

**i** 6 - Low Risk (Finding 1)

**Item:** Rocking Equipment - Four Way Springer  
**Manufacturer:** Fahr Industries

**Risk Level:** L - Low Risk  
**Surface:** Grass Matrix Tiles



**Finding:** The paintwork on this item has been damaged or worn exposing the metal underneath which is rusting / corroding

**Action:** Treat affected areas and repaint

**i** 5 - Very Low Risk (Finding 1)

**Item:** Activity Equipment - Multi Play (Junior)  
**Manufacturer:** Not Identified

**Risk Level:** V - Very Low Risk  
**Surface:** Bark Mulch



**Finding:** The item fails to meet the requirements of BS EN 1176 Part 1 4.2.7.2 head and neck entrapment in the barriers and/or steps

**Action:** Monitor - No action given the risk assessment

**i** 5 - Very Low Risk (Finding 2)

**Item:** Activity Equipment - Multi Play (Junior)  
**Manufacturer:** Not Identified

**Risk Level:** V - Very Low Risk  
**Surface:** Bark Mulch



**Finding:** There is/are finger entrapment/s in the bridge connections and the item fails to meet the requirements of BS EN 1176 Part 1 4.2.7.6 Entrapment of fingers

**Action:** Monitor - No action given the risk assessment

**i** 8 - Low Risk (Finding 3)

**Item:** Activity Equipment - Multi Play (Junior)  
**Manufacturer:** Not Identified

**Risk Level:** L - Low Risk  
**Surface:** Bark Mulch



**Finding:** There is or are fixings missing on the item

**Action:** Replace all missing fixings

**i** 8 - Low Risk (Finding 4)

**Item:** Activity Equipment - Multi Play (Junior)  
**Manufacturer:** Not Identified

**Risk Level:** L - Low Risk  
**Surface:** Bark Mulch



**Finding:** The fixings have corroded excessively

**Action:** Replace all corroded fixings

**i** 6 - Low Risk (Finding 5)

**Item:** Activity Equipment - Multi Play (Junior)  
**Manufacturer:** Not Identified

**Risk Level:** L - Low Risk  
**Surface:** Bark Mulch



**Finding:** There is some wear to the shackles.

**Action:** Monitor for any further deterioration and replace when 40% worn

**i** 8 - Low Risk (Finding 6)

**Item:** Activity Equipment - Multi Play (Junior)  
**Manufacturer:** Not Identified

**Risk Level:** L - Low Risk  
**Surface:** Bark Mulch



**Finding:** The depth of the loose fill surfacing is lower than the recommended depth specified in BS EN 1176; the free height of fall of the equipment is less than 2.0m and a minimum of 300mm depth should be provided (including an extra 100mm to allow for compaction and displacement as per BS EN 1176 Part 1 - Table 4)

**Action:** Top up loose fill surfacing to recommended levels

**i** 0 - Risk Assessment not Undertaken (Finding 1)

**Item:** Multi Use Games Area - Football Goal  
**Manufacturer:** Not Identified

**Risk Level:** N - Risk Assessment not Undertaken  
**Surface:** Grass



**Finding:** NB: We have undertaken a maintenance inspection only of the football goal(s); full load testing falls outside the scope of our inspection.

**Action:** Implement load testing as required

**i** 6 - Low Risk (Finding 2)

**Item:** Multi Use Games Area - Football Goal  
**Manufacturer:** Not Identified

**Risk Level:** L - Low Risk  
**Surface:** Grass



**Finding:** The item is slightly loose in its foundations

**Action:** Monitor for any further deterioration and repair as required

**i** 6 - Low Risk (Finding 3)

**Item:** Multi Use Games Area - Football Goal  
**Manufacturer:** Not Identified

**Risk Level:** L - Low Risk  
**Surface:** Grass



**Finding:** The paintwork on this item has been damaged or worn exposing the metal underneath which is rusting / corroding

**Action:** Treat affected areas and repaint

**i** 8 - Low Risk (Finding 4)

**Item:** Multi Use Games Area - Football Goal  
**Manufacturer:** Not Identified

**Risk Level:** L - Low Risk  
**Surface:** Grass



**Finding:** The net is damaged and requires removal / replacement

**Action:** Replace